

Work Order ID 74691



Page 1

Wednesday, October 05, 2011 10:26:34 AM

Item ID: D205-634-041

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 10/5/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 10/21/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: M.L.J Date: 11/10/05 Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D2580-041

~~Rev D DEC-01~~ E

11/10/05

100

0.00



DOCUMENT CONTROL

DC

Memo

0.00

Document Control

Photocopy D205-634 bluefile & type labels per PPP D205-634-041 CHG002

N/A DP

110

0.00



BENDING MACHINE - SKIDTUBES

CNC Bend 1

Memo

0.00

CNC Delta 100 Bender

1-Bend as per program D2580.C on CNC Bender and Folio 16

2-Cut tubes as per Dwg. D2580

3- scribe batch# in aft end of tube

DP 11-11-7

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 74691

Page 2

Wednesday, October 05, 2011 10:26:34 AM

Item ID: D205-634-041

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 10/5/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 10/21/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

0.00



Skidtubes

Memo

0.00

1- Deburr ends and remove bending marks

Skidtubes

2- Prepare tube for welding as per QSI 004

SAD 11-11-07

(1)

130

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

1 2 Ben/11/08

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 74691

Wednesday, October 05, 2011 10:26:34 AM



Page 3

Item ID: D205-634-041

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 10/5/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 10/21/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140

0.00



Skidtubes

0.00

Skidtubes

Memo

1-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R ☐ Aluminum Rod

M118736

BE 11/14/08

2-Grind welds on step as per Dwg D2580

3-Weld spacers as per dwg D2580

A/R M118736

BE 11/14/08

3- *** N/A **** Insert D4202-1 spacer, swage as per QSI002 and trim/ grind flush per QSI002 and dwg. Hold x-bolt with DT9701 Use tube expander 1/2 x17G to start expansion and finish with 1/2 x 18G to achieve dwg dimation.

4-Drill holes for wearplates using DT 8217 & DT8937 Open holes to 19/64", adjust stopper not to hit web. Debur

6-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Debur

7-Drill pilot holes for Tow ring using DT8091, open to .640" and Debur

BB 11/14/09

C-Bowl DP 11-11-10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 74691

Page 4

Wednesday, October 05, 2011 10:26:34 AM

Item ID: D205-634-041

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 10/5/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 10/21/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
150 QC Quality Control	QC10- Inspect visual per QSI004- ground welds Memo	0.00 0.00							
160 QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.00							
170 HandFinish Hand Finishing	Pressure Wash per QSI005 4.3 Memo Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch and leave fwd cap out of solution.	0.00 0.00							

1x Ø m 11/11/14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 74691

Page 6

Wednesday, October 05, 2011 10:26:34 AM

Item ID: D205-634-041

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 10/5/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 10/21/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

200

0.00



HandFinish

Memo

0.00

Hand Finishing

1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates
A/R ☐ ☐ ☐ Sikaflex-291 ☐ 119443 ☐ ☐
Sikaflex expire date: 12-01

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive
A/R ☐ ☐ ☐ Sikaflex-291 ☐ 119443 ☐ ☐
Sikaflex expire date: 12-01

5-Wing Walk as per Dwg D2580 and QSI 005 4.4
Batch: 118 980

1 BR 11-11-15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 74691

Wednesday, October 05, 2011 10:26:34 AM

Page 7

Item ID: D205-634-041

Accept

Setup Start

Revision ID:

Stop

Item Name: Replacement Skidtube

Start Date: 10/5/2011 Start Qty: 1.00

Cust Item ID:

Required Date: 10/21/2011 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

210 QC5- Inspect part completeness to step on W/O

0.00



QC

Quality Control

Memo

Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

0.00

S. W. W. S.

220

0.00



Packaging

Packaging

Packaging

Memo

Identify and pack for shipping as per PPPD205-634-041

Location: _____

PPP Rev: _____

0.00

PP 76240

11/11/16

230

0.00



QC

Quality Control

QC21- Final Inspection - Work Order Release

Memo

0.00

11/11/16

ME 11-11-16

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Page 1

Wednesday, October 05, 2011 10:26:50 AM

Work Order ID: 74691

Parent Item: D205-634-041

Parent Item Name: Replacement Skidtube

Start Date: 10/5/2011

Required Date: 10/21/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30
KJ IPP Rev P 10.02.19
per PAR09-043 EC verified by:DD
IPP Rev. O 06.02.28 Added paperwork EC
IPP Rev:P 07-07-09 SS Wearplates & Gaskets JLM IPP Rev:Q
10.12.01 as per chg003 DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D4202-1 Spacer	D2579	Manufactured	No			140	Each	443.0000	20	20		BE 11/10/08 B 73751 *20	
-------------------	-------	--------------	----	--	--	-----	------	----------	----	----	--	----------------------------	--

Location	Loc Qty	Loc Code
LG002	443	
66929	106	
67129	196	
67308	1	
67430	140	

D2580-1 205 Skidtube bent detail		Manufactured	No			110	Each	1.0000	1	1		SAD 11-12-07	
-------------------------------------	--	--------------	----	--	--	-----	------	--------	---	---	--	--------------	--

Location	Loc Qty	Loc Code
LG	1	
72965	1	

D2576-3 Step (maching detail)		Manufactured	No			140	Each	71.0000	1	1		BE 11/10/08	
----------------------------------	--	--------------	----	--	--	-----	------	---------	---	---	--	-------------	--

Location	Loc Qty	Loc Code
LG	71	
66156	21	
70883	50	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, October 05, 2011 10:26:50 AM

Work Order ID: 74691

Parent Item: D205-634-041

Parent Item Name: Replacement Skidtube

Start Date: 10/5/2011

Required Date: 10/21/2011

Start Qty: 1.00

Required Qty: 1.00

D2855 Manufactured No 200 Each 18.0000 1 1



Cap



BR 11-11-15.

Location

Loc Qty

Loc Code

FP007

18

65519

2

65569

16

AN3-5A Purchased No 200 Each 886.0000 2 2



Bolt



BR 11-11-15.

Location

Loc Qty

Loc Code

ST350

886

115371

46

117423

540

118626

300

AN960JD10L * NAS1149D0332J Purchased No 200 Each 0.0000 2 2



Washer

117087.



2- BR 11-11-15.

ALS7-1032-130 Purchased No 200 Each 1,255.000 50 50



Insert



BR 11-11-15.

Location

Loc Qty

Loc Code

ST281

1000

118966

1000

ST282

255

117717

109

118386

146

50.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, October 05, 2011 10:26:51 AM

Work Order ID: 74691

Parent Item: D205-634-041

Parent Item Name: Replacement Skidtube

Start Date: 10/5/2011

Required Date: 10/21/2011

Start Qty: 1.00

Required Qty: 1.00

AN3C4A

Purchased

No

200

Each

2,147.000

50

50



BOLT



BR 11-11-15.

Location

Loc Qty

Loc Code

ST350

2147

117313

2

117688

5

117872

22

118112

16

118451

602

118706 ✓

500

118838

1000

50.

AN960C10L

*
R

NAS1149C0332

Purchased

No

200

Each

0.0000

50

50



washer

D3566-13

Manufactured

No

200

Each

40.0000

1

1



Gasket



50.

BR 11-11-15.

118354

Location

Loc Qty

Loc Code

FP

29

73322 ✓

29

FP014

11

68341

1

72149

10

1

BR 11-11-15.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Page 4

Wednesday, October 05, 2011 10:26:51 AM

Work Order ID: 74691

Parent Item: D205-634-041

Parent Item Name: Replacement Skidtube

Start Date: 10/5/2011

Required Date: 10/21/2011

Start Qty: 1.00

Required Qty: 1.00

D3566-5

Manufactured No

200

Each

18.0000

1

1



Gasket



BR 11-11-15.

Location

Loc Qty

Loc Code

FP002

12

74387 ✓

12

FP015

6

72849

6

D3566-1

Manufactured No

200

Each

27.0000

2

2



Gasket



BR 11-11-15.

Location

Loc Qty

Loc Code

FP002

25

73303 ✓

25

FP015

2

68924

2

D3564-11

Manufactured No

200

Each

14.0000

1

1



Wearshoe



BR 11-11-15

Location

Loc Qty

Loc Code

FP019

12

73146 ✓

12

FP020

2

72207

2

Wednesday, October 05, 2011 10:26:52 AM

Shop Packet Print

Page 4

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, October 05, 2011 10:26:52 AM

Work Order ID: 74691



Parent Item: D205-634-041



Parent Item Name: Replacement Skidtube

Start Date: 10/5/2011

Required Date: 10/21/2011

Start Qty: 1.00

Required Qty: 1.00

D3564-13

Manufactured No

200

Each

26.0000

1

1



Wearshoe



BL 11-11-15.

Location

Loc Qty

Loc Code

FP001

25

72850

7

73323 ✓

18

FP017

1

71594

1

D3564-9

Manufactured No

200

Each

24.0000

1

1



Wearshoe



BL 11-11-15.

Location

Loc Qty

Loc Code

FP

19

73345 ✓

19

FP019

5

67590

4

69943

1

D3564-5

Manufactured No

200

Each

20.0000

1

1



Wearshoe



BL 11-11-15.

Location

Loc Qty

Loc Code

FG

2

34806

2

FP19

18

73330 ✓

18

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, October 05, 2011 10:26:52 AM

Work Order ID: 74691

Parent Item: D205-634-041

Parent Item Name: Replacement Skidtube

Start Date: 10/5/2011

Required Date: 10/21/2011

Start Qty: 1.00

Required Qty: 1.00

D2594-3 Manufactured No

200

Each

884.0000

16

16



O-Ring, 205 Skidtube



BR 11-11-15.

Location

Loc Qty

Loc Code

FP004

198

73490

198

FP-A

686

65518

41

66952

347

73490

298

16.

D2594-1 Manufactured No

200

Each

254.0000

16

16



Plug, 205 Skidtube



BR 11-11-15.

Location

Loc Qty

Loc Code

FP

172

73401

172

FP-A

82

42807

28

67441

7

72127

47

16.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

LIST OF MATERIALS					PART NUMBER	DESCRIPTION
ITEM	QTY -041	QTY -045	QTY -047			
1	X				D2580-041	SKIDTUBE ASSEMBLY
2		X			D2580-045	SKIDTUBE ASSEMBLY
3			X		D2580-047	SKIDTUBE ASSEMBLY
4	1	1	1		D2500-1-190	EXTRUSION
5			16		D2570	BUSHING
6	1	1	1		D2576-3	STEP
7	20	24	25		D2579	SPACER
8	16	16	8		D2594-1	PLUG
9	16	16	8		D2594-3	O-RING
10	1	1	1		D2596	205 WEB
11	1	1	1		D2855	AFT CAP
12	1	1			D3564-5	WEARSHOE
13	1	1			D3564-9	WEARSHOE
14	1	1			D3564-11	WEARSHOE
15	1	1			D3564-13	WEARSHOE
16	2	2			D3566-1	GASKET
17	1	1			D3566-5	GASKET
18	1	1			D3566-13	GASKET
19			1		D4406-041	WEARPLATE ASSEMBLY
20			1		D4406-043	WEARPLATE ASSEMBLY
21	50	50			ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
22	50	50			AN3C4A	BOLT
23	2	2	2		AN3-5A	BOLT
24			8		AN4-45A	BOLT
25	50	50			NAS1149C0332R	WASHER (AN960C10L)
26	2	2	2		NAS1149D0332J	WASHER (AN960JD10L)
27			8		MS21042-4	NUT (OR MS21042L4)

GENERAL NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ASSEMBLY (-041/-047) GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
POWDER COAT ASSEMBLY (-045) GREEN SANDEX (REF 4.3.5.8) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D2580-041 = 34.5 lbs
D2580-045 = 34.5 lbs
D2580-047 = 37.7 lbs
- 8) WELDING PER DART QSI 004.
- 9) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 10) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 11) USE DART DRILL TEMPLATE DT8217 & DT8937 ONLY FOR D2580-041/-045 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTIONS B-B AND F-F (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241/291.
- 12) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES FOR D2580-041/-045 AND 8 PLACES FOR D2580-047)
- 13) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

RELEASED
2011-08-29

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER

NO. 34691 M.L.J
11/10/05

E	ADD D2580-047 (ZN C4-7) AND D2580-7 (ZN B3-8); INCLUDED DEO D2580-D-1; REFORMATTED DRAWING TO CURRENT STANDARDS; DT8217 & DT8937 WAS TD2577-205 (ZN C4-1)	RF	11.06.21
D	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/ 9183	PH	07.04.05
C	REDRAWN, INCLUDED DEO 9094/ 9097	CP	98.08.26
B	AS MANUFACTURED	DS	96.12.02
A	NEW ISSUE	DS	96.09.16
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN	RF		
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	11.06.21		

DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA

DRAWING NO. REV. E
D2580 SHEET 1 OF 8
TITLE SCALE
205 SKIDTUBE ASSEMBLY NTS

COPYRIGHT © 1996 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

74091

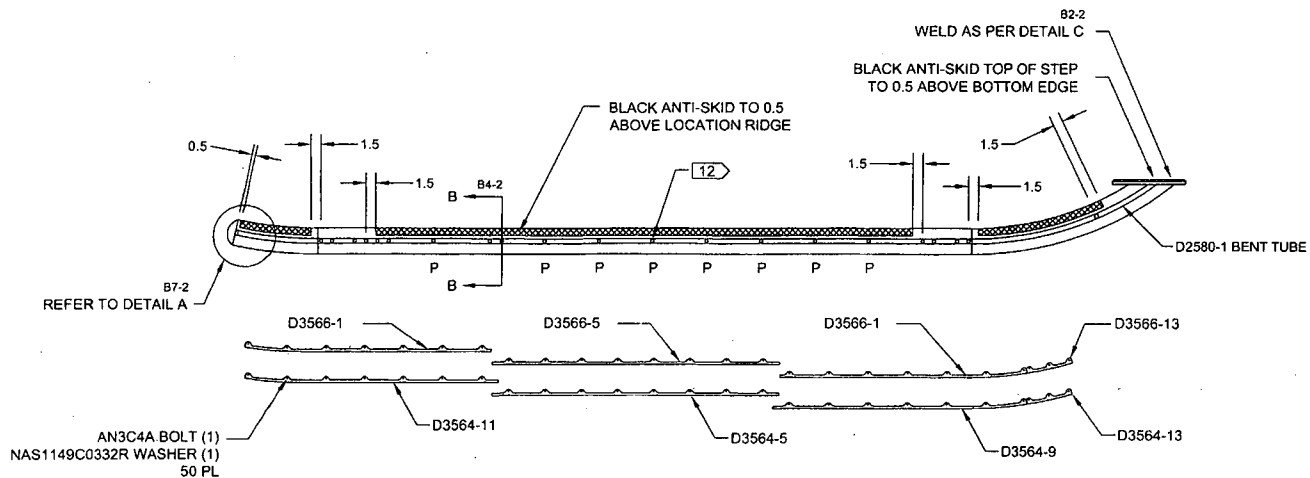


D2580-041 ASSEMBLY DETAIL

DETAIL A C7-2
SCALE 5X

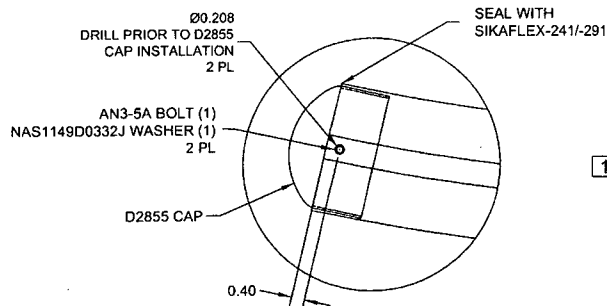


SECTION B-B D5-2
SCALE 5X

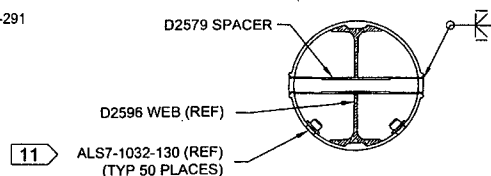

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

DETAIL C D3-2
SCALE 5X

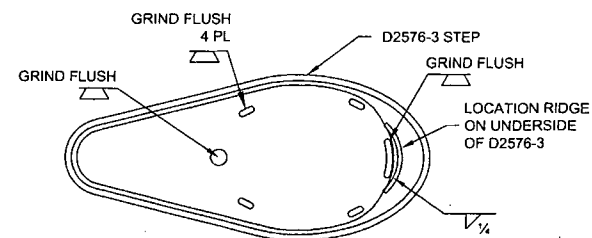

RELEASED
2011-08-29

DESIGN	#	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	10	DRAWING NO.	REV. E
MFG. APPR.	10	D2580	SHEET 2 OF 8
APPROVED	10	TITLE	SCALE
DE APPR.	10	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

74691

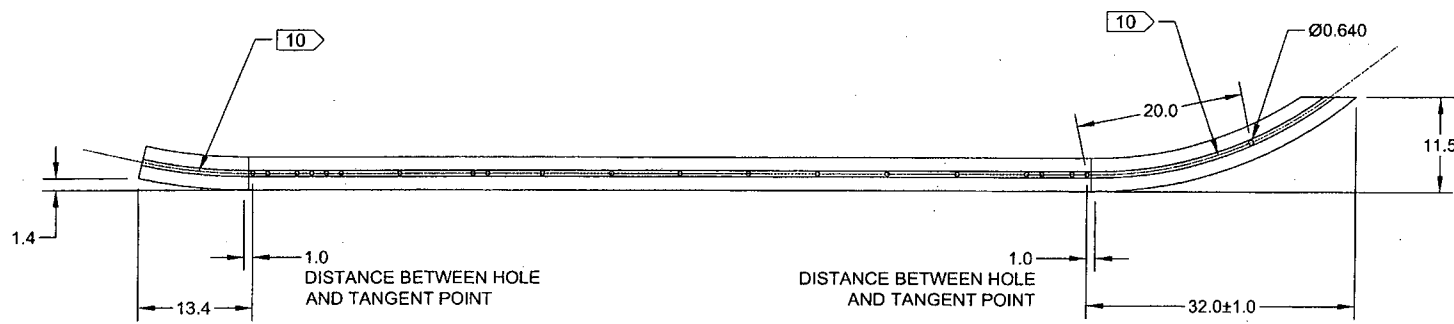

D2580-1 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2011-08-28
JW

DESIGN	#	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	10	DRAWING NO.	REV. E
MFG. APPR.	10	D2580	SHEET 3 OF 8
APPROVED	10	TITLE	SCALE
DE APPR.	10	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____



NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


74691

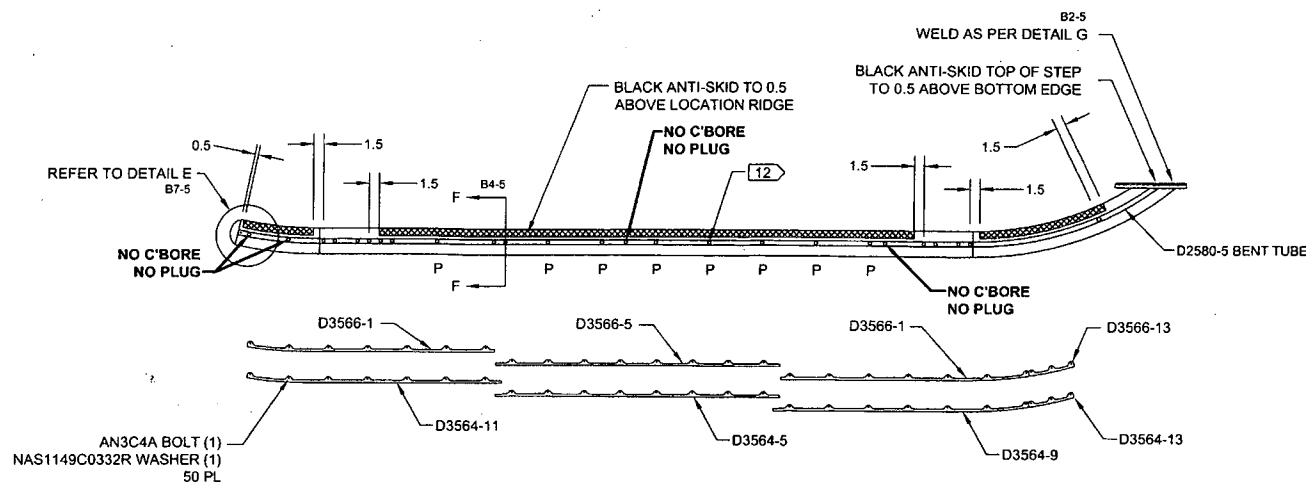

D2580-045 ASSEMBLY DETAIL

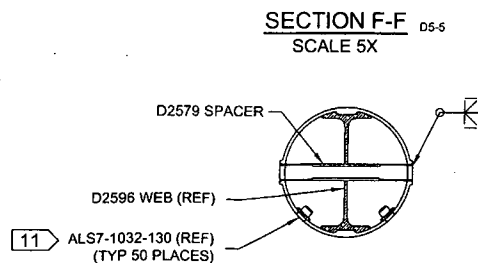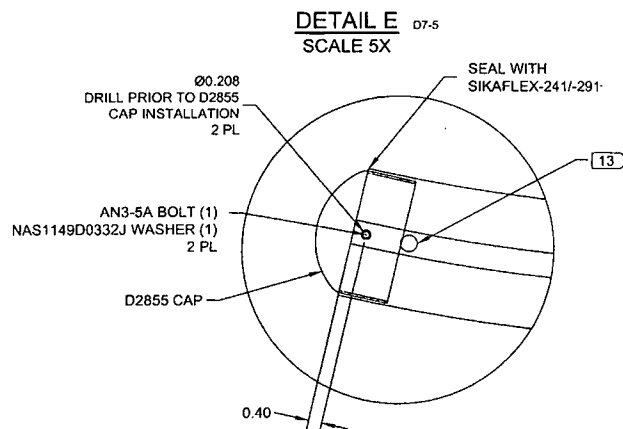

- AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
 2. INSERT D2579 SPACER (24 PLACES)
 3. WELD INTO PLACE AND GRIND FLUSH
 4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

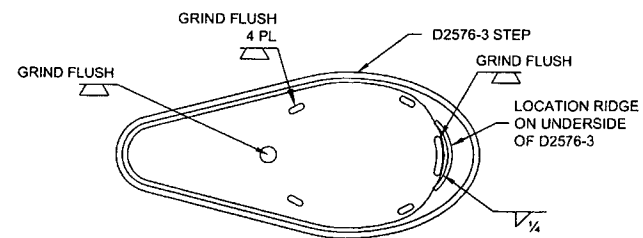

DESIGN	RF	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	RF	D2580	SHEET 4 OF 8
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	COPYRIGHT © 1996 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

74691

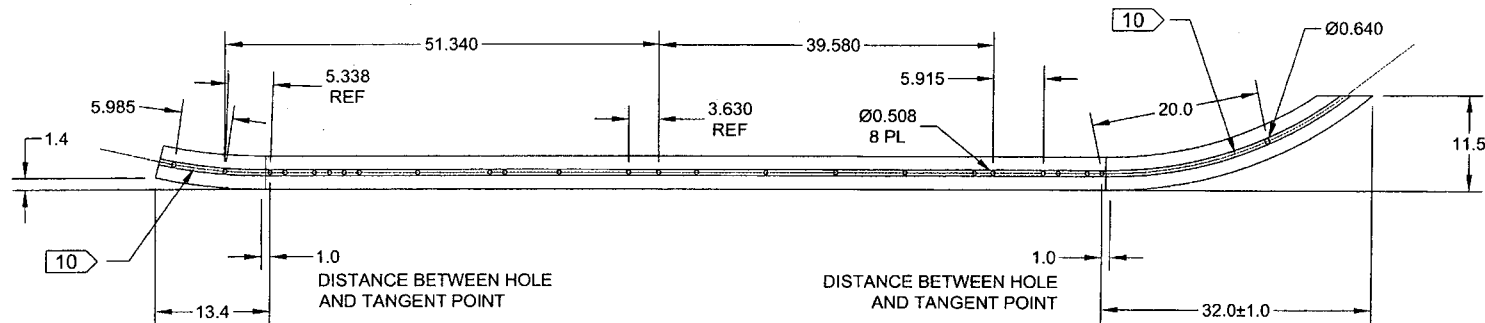

D2580-5 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2011-08-29

DESIGN	#	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	140	DRAWING NO.	REV. E
MFG. APPR.	140	D2580	SHEET 5 OF 8
APPROVED	140	TITLE	SCALE
DE APPR.	140	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


74691

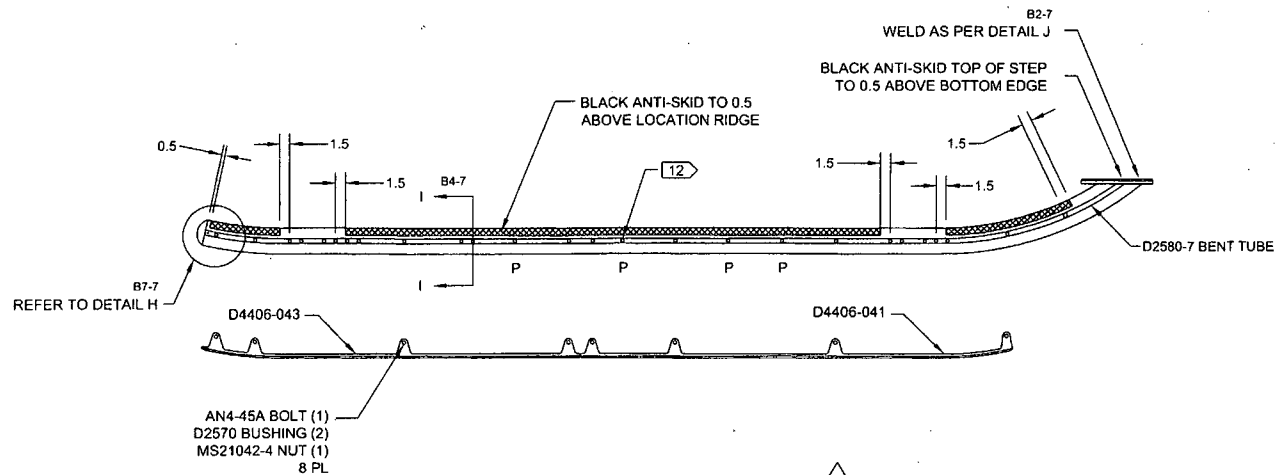

D2580-047 ASSEMBLY DETAIL E

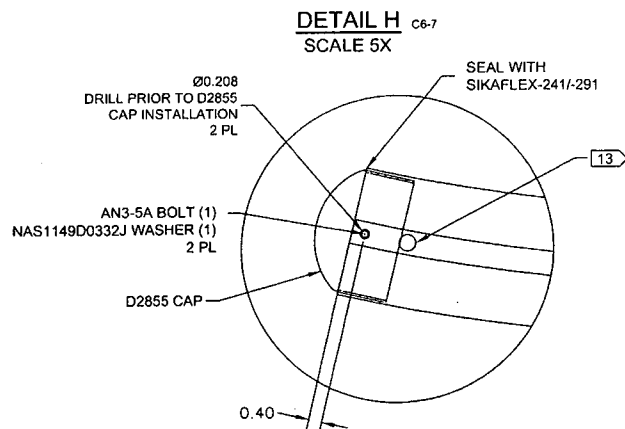


DETAIL H SCALE 5X

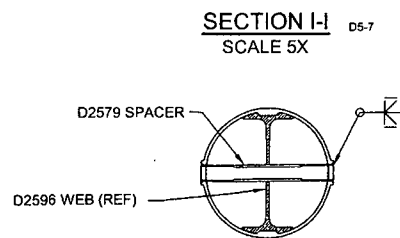

SECTION I-I SCALE 5X

- AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
 2. INSERT D2579 SPACER (25 PLACES)
 3. WELD INTO PLACE AND GRIND FLUSH
 4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

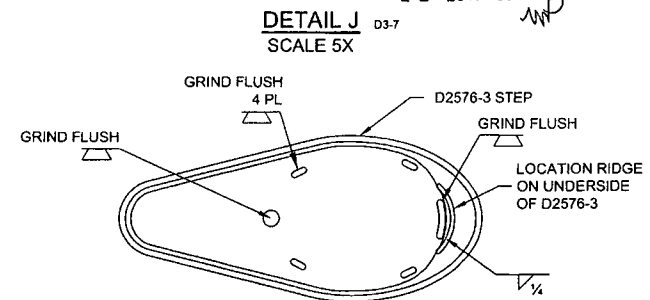

DETAIL J SCALE 5X

DESIGN	#	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	10	DRAWING NO.	REV. E
MFG. APPR.	10	D2580	SHEET 6 OF 8
APPROVED	10	TITLE	SCALE
DE APPR.	10	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	<small>COPYRIGHT © 1998 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

74691

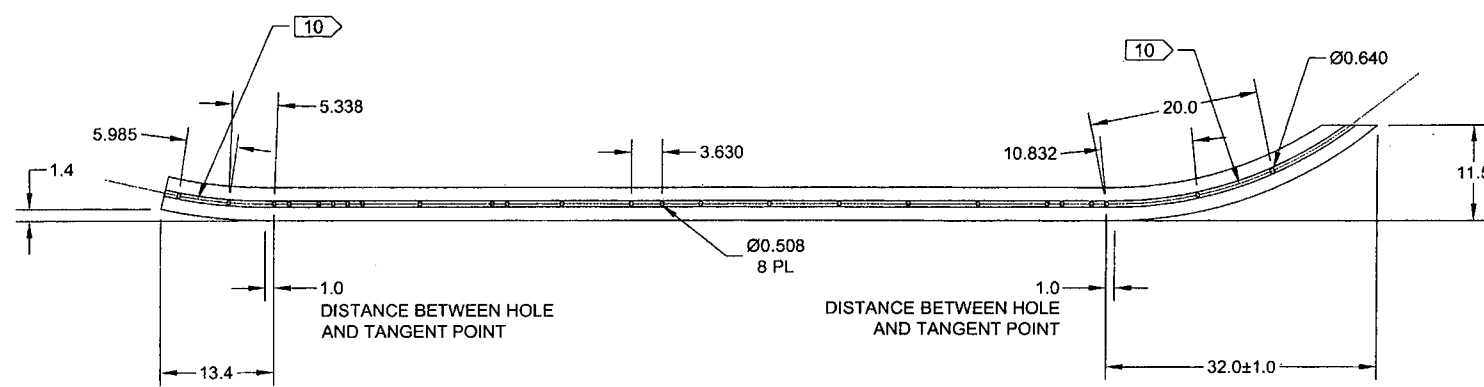

D2580-7 BENT TUBE
(MAKE FROM D2580-101 TUBE)



RELEASED
2011-08-29
W

DESIGN	RF	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	RF	DRAWING NO. D2580	REV. E
MFG. APPR.	RF	SHEET 7 OF 8	
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

74691

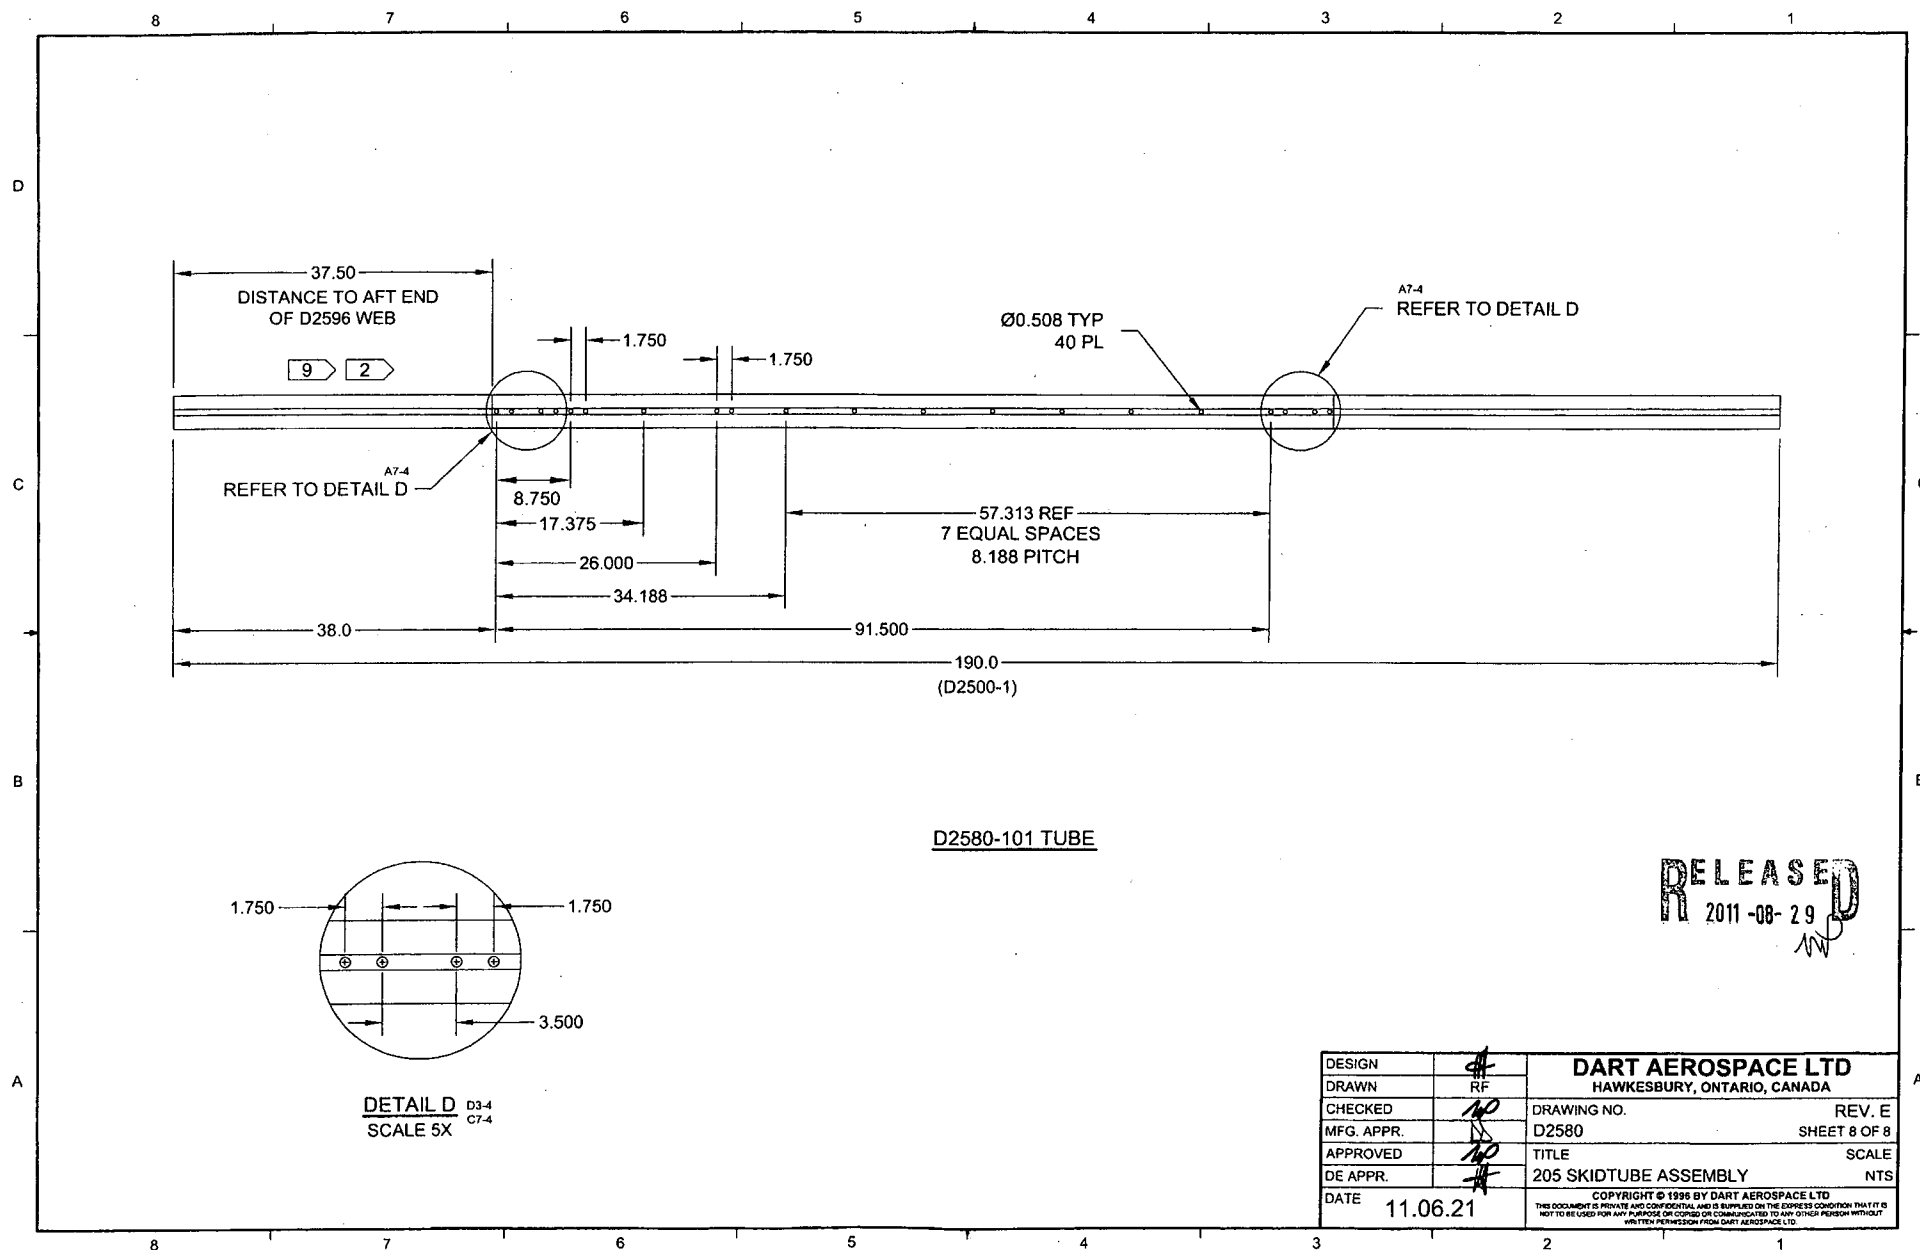

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

NO. 271

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barclay Elliott
Job number: 72859
Part number: 1 205 - 634 - 041
Description: 205 Skid tube
Welding Process: Tig[☒] Mig[]
Base material: Aluminium
Current: AC[☒] DC[]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[]
Penetration: pass[☒] fail[]

UNACCEPTABLE

Cracks: pass[☒] fail[]
Undercut: pass[☒] fail[]
Pin holes: pass[☒] fail[]
Overlap (cold lap): pass[☒] fail[]
Porosity (surface): pass[☒] fail[]
Coloration: pass[☒] fail[]

Qualifier Pat. Dunn Date of Test Coupon 11-10-12
Welder Barclay Elliott Date of Test Coupon 11-10-12

The above named individual is qualified in accordance with AWS D17.1.2001 to weld